




Smoke and Dye-Water Observation Summary

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

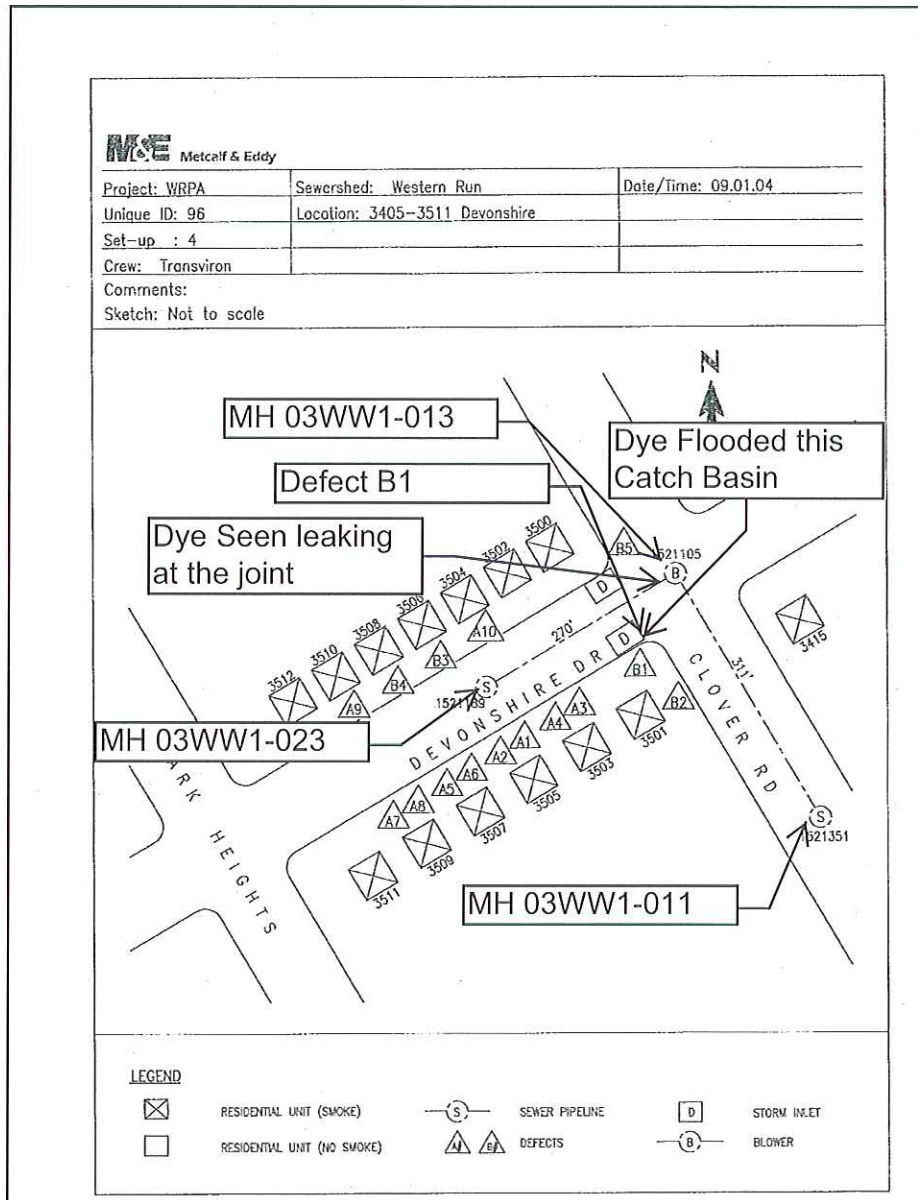

INSPECTION REPORT

DATE: 04/11/2005	WORK ORDER:	WEATHER: SUNNY, DRY	OPERATOR: J.A.M.	SECTION NR: 35	SECTION NAME:
PRESENT:	VEHICLE: TV 175	CAMERA: PAN/TILT	PRESET:	CLEANED: NO	RATE: 860

STREET: DEVONSHIRE DR. 96 B 5 + B1	MAP #1: 1	MH: 1521105
CITY: BALTIMORE	MAP #2:	MH: 1521189
LOCALE: SMALL RESIDENTIAL STREET	TAPE #: JAM 4	TV'D LGTH: 21.43 ft
INSPECT REASON: DYE TESTING	PIPE SIZE: 8 in	
SECTION TYPE: WASTEWATER	MATERIAL: VCP JT LGTH: 3 ft	
AREA: 01-WR19	LINING: NO RELINING	
RSRVD:		
REMARK: DYE TEST 96 B 5		

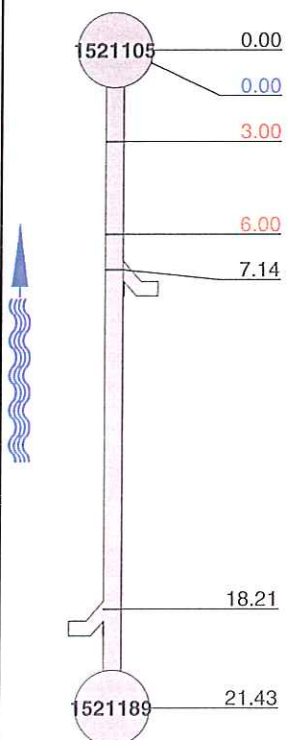1:75	DIST	OBSERVATION	RATE	VCR #	PH
	0.00	inspection begins at downstream manhole, 1521105	0	00:00:00	
	0.00	Infiltration Seeping at joint at 04 o'clock	2	00:00:29	2a
	3.00	Infiltration Running at joint from 04 to 08 o'clock	3	00:02:07	3a, b
	6.00	Infiltration Running at joint at 08 o'clock	3	00:02:31	
	7.14	service connection capped at 09 o'clock	0	00:02:50	
	18.21	service connection capped at 03 o'clock	0	00:04:05	
	21.43	inspection ends, NO MORE DYE TEST LEAKS SEEN.	0	00:04:27	7a

INSPECTION IMAGES

CITY: BALTIMORE	STREET: DEVONSHIRE DR. 96 B 5	DATE: 04/11/2005	SECTION NR: 35	SECTION NAME:
--------------------	----------------------------------	---------------------	-------------------	---------------



IMAGE: 2a, TAPE #: JAM 4, 00:00:29
0FT, Infiltration Seeping at joint at 04 o'clock



IMAGE: 3a, TAPE #: JAM 4, 00:02:07
3FT, Infiltration Running at joint from 04 to 08 o'clock



IMAGE: 3b, TAPE #: JAM 4, 00:02:07
3FT, Infiltration Running at joint from 04 to 08 o'clock



IMAGE: 7a, TAPE #: JAM 4, 00:04:27
21.43FT, inspection ends, NO MORE DYE TEST LEAKS SEEN.